# Installation Instructions for the SR2 Series Hall-Effect Position Sensors

ISSUE 2 PK 88581

## ELECTRICAL AND MAGNETIC SPECIFICATIONS

		SR2C-B4	
Supply Voltage, VDC		4.5 to 24	
Supply Current, mA max.		10	
Output Type		NPN	
Output Voltage, max.		0.40 V	
Output Current, mA max.		40	
Magnetic Type	*	Unipolar	
-40 to 100°C	Max. Op.	220	
	Min. Rel.	50	
	Min. Diff.	8	
+25°C	Тур. Ор.	150	
	Typ. Rel.	80	
	Typ. Diff.	10	

<sup>\*</sup> A unipolar sensor has a plus maximum operate point and a plus minimum release point. One magnetic pole (south) is required to operate and release a unipolar sensor.

#### **ABSOLUTE MAXIMUM RATINGS\***

<u>/ 12002012 111 111 111 111 111 111 111 11</u>			
Parameters	4.5 to 24 VDC Circuit		
Supply Voltage (Vs)	-1.0 to +25 VDC		
Voltage Externally Applied to Output	-0.5 V max. (ON or OFF) +25 V max. (OFF only)		
Output Current	40 mA		
Temperature, Operate and Storage	-40 to +100°C (-40 to +212°F)		
Magnetic Flux	No limit. Circuit cannot be damaged by magnetic overdrive.		

<sup>\*</sup> Absolute maximum ratings are the extreme limits that the device will withstand without damage to the device. However, the electrical and magnetic characteristics are not guaranteed as the maximum limits (above recommended operating conditions) are approached, nor will the device necessarily operate at absolute maximum rating.


#### **LEADWIRE COLOR CODE**

Red Vs (+)
Black Ground (-)
White Output (Digital)


### NOTICE

**Do not** reverse supply voltage polarity. **Do not** exceed maximum ratings.

#### **MOUNTING DIMENSIONS** (for reference only)

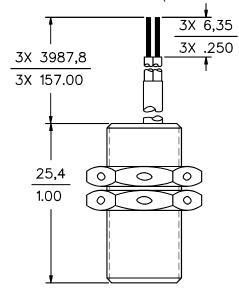

#### **1SR15 Mounting Bracket**

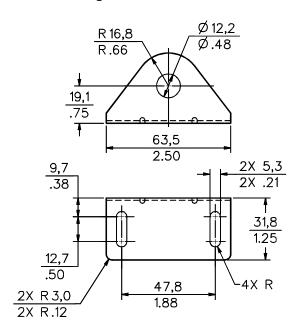

SR2 Series PK 88581

#### TROUBLESHOOTING

If sensor does not operate, follow these steps:

- 1. Make certain wiring is correct (load must be connected).
- Measure supply voltage across the Red (+) and Black (-) leads to verify that proper supply voltage is present.
- 3. Connect positive lead of voltmeter to White (output) lead, and negative voltmeter lead to Black (-) lead. With magnet removed (or north pole present), the reading should equal Vs.
- 4. When the magnet (south pole) moves toward sensor face (beyond operating point), the sensor output should be 0.40 VDC.

#### WARRANTY/REMEDY

Honeywell warrants goods of its manufacture as being free of defective materials and faulty workmanship. Commencing with date of shipment, Honeywell's warranty runs for 18 months. If warranted goods are returned to Honeywell during that period of coverage, Honeywell will repair or replace without charge those items it finds defective. The foregoing is Buyer's sole remedy and is in lieu of all other warranties, expressed or implied, including those of merchantability and fitness for a particular purpose.

For application assistance, current specifications, pricing or name of the nearest Authorized Distributor, contact a nearby sales office. Or call:

1-800-537-6945 USA

1-416-293-8111 Canada

1-815-235-6847 International

http://www.honeywell.sensing.com


info.sc@honeywell.com


Specifications not affecting form, fit or function may change without notice. The information we supply is believed to be accurate and reliable as of this printing. However, we assume no responsibility for its use.


While we provide application assistance, personally and through our literature, it is up to the customer to determine the suitability of the product in the application.


#### **CURRENT SINKING OUTPUTS**

(Current flow through load into sensor.) Output terminal is open collector. In the unoperated condition ( $I_L = 0$ ), the output voltage is normally high.

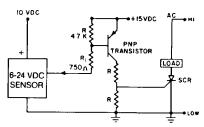

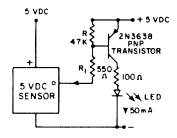

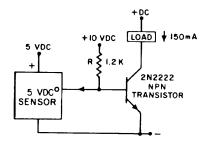

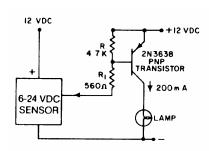

Honeywell

#### **Sensing and Control**

Honeywell

11 West Spring Street Freeport, Illinois 61032

Printed with Soy Ink on 50% Recycled Paper PK 88581-2 0303 Printed in USA