



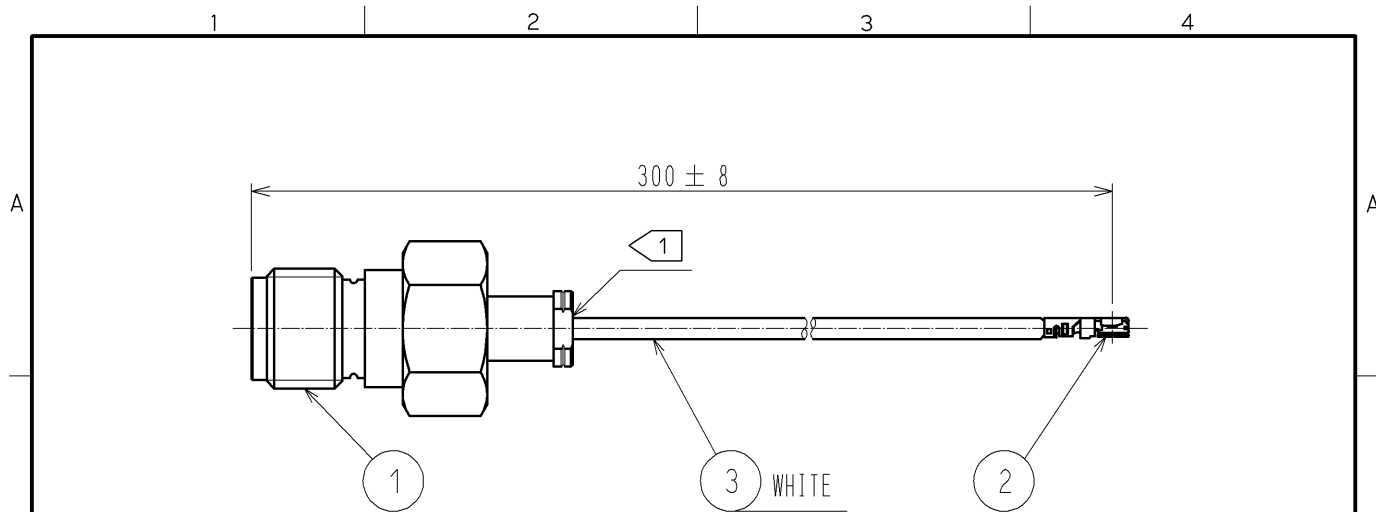


- NOTE
- 1 Do not apply any excessive stress to the cable assembly position.
 - 2 The drawing shows mated connector height only.

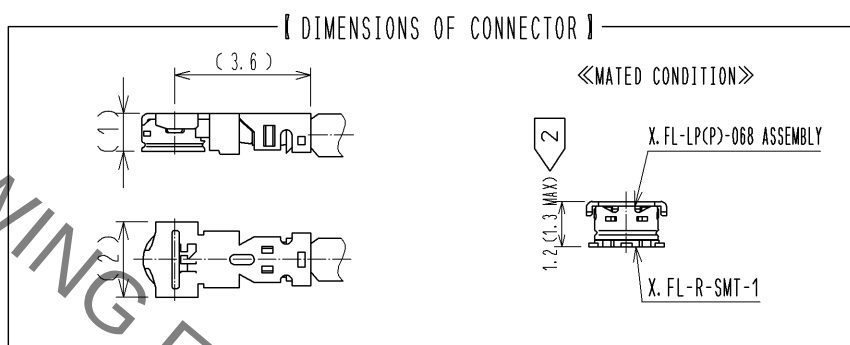

[PRECAUTIONS FOR HANDLING]

- ◆ Connector insertion and extraction
 - a. Insert the connector as perpendicularly to the mating surface as possible with aligning the mating axes of both connectors by specialised insertion JIG.
Part No. : W.FL-LP-IN(CL331-0323-2) or X.FL-LP-IN.OUT1(CL331-0715-2)
Do not excessively slant the connectors when inserting.
 - b. connector shall be extracted by specialised extraction JIG.
Part No. : X.FL-LP-IN.OUT1(CL331-0715-2)
Never hold the cable when extracting the cable because it damages the connector.

- ◆ Allowable loads on the cable after the connectors are mated.
The right figures show the maximum allowable loads on the cable.
Do not apply loads exceeding these values to the cable.

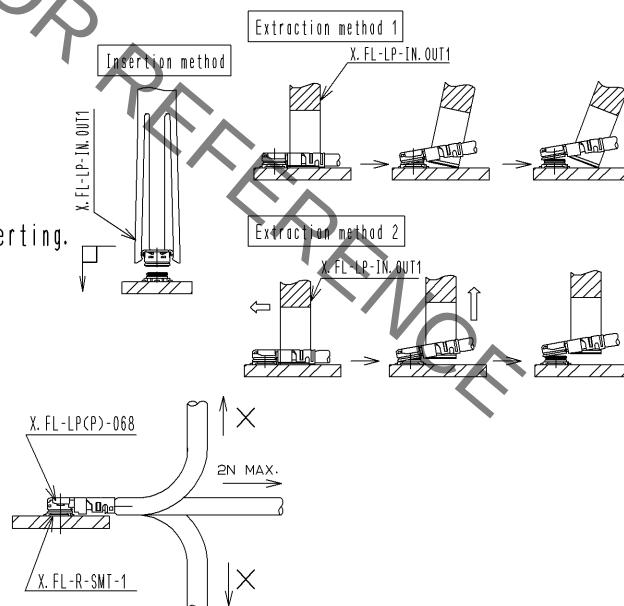

RoHS COMPLIANT

2	X.FL-LP(P)-068	CL331-0714-0-00				
1	HRM-200-066JBN(40)	CL323-0793-1-40	3	FWS5064(WHITE)	KURABE INDUSTRIAL CO., LTD.	
NO.	PART NO.	CODE NO.	NO.	PART NO.	MANUFACTURER	
UNITS mm		SCALE FREE	COUNT 	DESCRIPTION OF REVISIONS		DESIGNED
						CHECKED
						DATE
HIROSE ELECTRIC CO., LTD.		APPROVED : KY. SHIMIZU	14. 11. 17	DRAWING NO.	EDC4-361456-02	
		CHECKED : TO. KATAYAMA	14. 11. 17	PART NO.	HRMJ-X.FL-068K3TS-A-300RS	
		DESIGNED : YI. FUNADA	14. 11. 14	CODE NO.	CL321-6605-0-02	
		DRAWN : YI. FUNADA	14. 11. 14		1/1	